


TENSIONER INSTALLATION UPDATE

Ford Explorer Auto 4.0L SOHC 12V

Front Left Hydraulic Tensioner

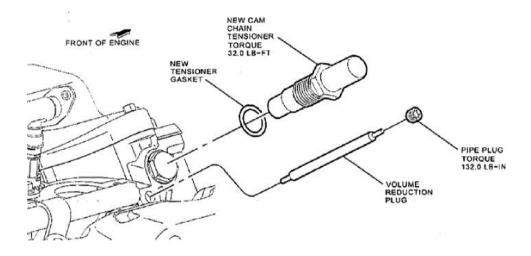

- 1. Remove Tensioner
- 2. Remove Pipe Plug and Volume Reduction Plug
- 3. Install new Tensioner and Gasket and tighten to 44Nm (32 ft.lbs.)
- 4. Install new Volume Reduction Plug
- 5. Install new Pipe Plug and tighten to 15 Nm (132in lbs.)

Volume Reduction Plug helps maintain proper oil flow.

OVER TORQUING THE TENSIONER CAN CAUSE ENGINE DAMAGE!!

SA8438